



Report Date: Thursday, May 02, 2019

Page 1 of 4

Service# 186596855

Problem: SZZ OTHER SEWER PROBLEM (USE COMMENTS)

Address(I): 48 ST

APT:

Cross Street: 37 AVE

ZIP: 11101

Pct: 114

Borough: QUEENS

Compass Direction:

SegmentID:

Building ID: 0

Block:

Lot:

CMBD: 401

Location:

District:

Parcel:

Area: 4

QUEENS

Sub-Area: 401 QUEENS COMMUNITY BOARD 1

# of Calls:	N/A	Occurred Date:	N/A	Call Date:	07-02-2018 05:15 PM
Taken By:	12645	GRATE, TIERNEY		Request Date:	07-02-2018 05:15 PM
Responsibility:	SQN	SEWER MAINTENANCE-QUEENS N.		Source:	ECC- EMERGENCY COMMAND CENTER
Scheduled Date:	N/A	Start Date:	07-05-2018 10:00 AM	Priority:	Z- DEFAULT PRIORITY
Inspector:	7060	YAP, RICHMANN		Inspection Date:	07-05-2018 10:30 AM
Resolution Code:				Resolution Date:	N/A
Customer Contact Requested:	N	Incident Date:	N/A	Due Date:	N/A

Primary Caller Information

Title:		Reference#	N/A	CallerKey:	186596855
Last Name:	DEP	Evening Phone:	N/A		
First Name, MI:	ABRUSI	Cell Phone:	N/A		
Address:		Day Phone:	(718)595-5816		
City/State/Zip:				Call Date:	07-02-2018 05:15 PM
Caller Comments:	CREATED FOR THE YARD - INVESTIGATE THE AREA				

Log Type	Log Started	Log Ended	Log By	Comments
INITIAL	07-05-2018	07-05-2018	7060-YAP, RICHMANN	Yap/Rivera veh#261During heavy rain fall (6-28-18), intersection of 48St & 37Ave flooded. Request cmom televise combined sewer to determine if combined line is adequate enough to take all that rain fall from so many catch basins attached to it. Input By: LINDA BUSH on 7/6/2018 3:01:55 PM
INITIAL	07-03-2018	07-03-2018	5325-PETERS, ANTHONY	48 ST BTWN 37 AND BARNETT AVES07/03/2018 0800-1205 YAP VEH#261FURCI-BULLOCK-THOMAS TRK#464/593ARRIVED AT LOCATION AND INSPECTED FOURTEEN (14) CATCH BASINS ON 48 ST FROM 37 AVE TO BARNETT AVECB#431600, 431601,431603,431604,431606,431607,431608CB #431609,432613,432615 AND 431499 ARE SINGLE HIGHWAY UNITS WITH NO CURB PIECE ELEVEN (11) IN TOTALCB#431602,431605,432614 AND 431499 ARE OPEN CURB PIECECATCH BASINS FOUR (4) IN TOTALCB#431601,431602,431603,431604,431605,431606 AND 431607 HAD DEBRIS SITTING ON TOP OF GRATE BLACK TOYOTA PRIUS (SHOWN IN E-MAIL PHOTO)STILL PARKED OVER CB#431604 WITH PASSENGER BACK TIRE SITTING OVER GRATE AND BLOCKING DRAINAGE HOLES CB#431605 HAD CARDBOX (CARTON BOX) Input By: ANTHONY A PETERS on 7/19/2018 10:34:54 AM



Report Date: Thursday, May 02, 2019

Page 2 of 4

Log Type	Log Started	Log Ended	Log By	Comments
INITIAL	07-03-2018	07-03-2018	5325-PETERS, ANTHONY	07/03/2018 0800-1205 YAP VEH#261FURCI-BULLOCK-THOMAS TRK#593/464CLEANED TO THE BOTTOM SIX (6) CATCH BASINS FLUSHED SIX (6) BASIN CONNECTIONS ALL TAKING WATERAND CLEAN AND CLEARCB CONN NO.431601 LINER IS DETACHED FROM CROWN OF PIPE APPROX 2 FT FROM CATCH BASIN FLUSHER WAS ABLE TO RE-OPEN NOW FUNCTIONING (STILL NEEDS TO BE REPAIRED) REMOVED ABOUT TWO (2) CUBIC YARDS OF DEBRIS FROM FIVE (5) CATCH BASINS WORK TO CONTINUEINSPECTION COMPLETE 7*19*2018 1047 AP Input By: ANTHONY A PETERS on 7/19/2018 10:46:46 AM
INITIAL	07-03-2018	07-03-2018	5325-PETERS, ANTHONY	07/03/2018 0800-1205 YAP VEH#261FURCI-BULLOCK-THOMAS TRK#593/464CB#431605 HAD CARDBOX (CARTON BOX) COVERING PORTION OF GRATE PROBED ABOVE MENTIONS CATCH BASINS RELATIVELY CLEAN WORK TO CONTINUE AS BASINS BECOME ACCESSIBLE RECOMMEND CB#431603,431604,431606 AND 431607 BR REVERTED BACK TO CATCH BASINS WITH OPEN CURB PIECE TO ALLOW EXCESSIVE WATER FLOW TO EXIT INTO BASINS DURING HEAVY RAINFALL ALSO RECOMMEND L.I.R.R. ADDRESS WATER RUN-OFFAND GRAVEL DEBRIS THAT ESCAPE FROM THEIR EMBANKMENT AND GATED ACCESS WAYINSPECTION COMPLETE 7.19.18 1115 AP INSPECTION COMPLETE 7*19*2018 1047 AP Input By: ANTHONY A PETERS on 7/19/2018 11:15:54 AM
FOLLOWUP	07-05-2018	07-05-2018	5325-PETERS, ANTHONY	07-05-2018 0825-1015 MUNIZ trk#463CLEANED FOUR (4) BASINS TO THE BOTTOMFUNCTIONING OTHERS C.O.B. AT THIS TIMEINSPECTION COMPLETE 7.19.18 1133 AP Input By: ANTHONY A PETERS on 7/19/2018 11:37:28 AM
FOLLOWUP	07-05-2018	07-05-2018	5325-PETERS, ANTHONY	07-05-2018 1015-1315 MUNIZ trk#463REPAIR BASIN NO.431608 AT 48 ST AND 37 AVEREMOVE ASPHALT AND OLD CASTING INSIDE UNITNO PARKING REGULATIONS SEND WORK ORDER TO Q/REPAIRS FOR MINOR BRICKWORKINSPECTION COMPLETE 7.19.18 1148 AP Input By: ANTHONY A PETERS on 7/19/2018 11:49:36 AM
FOLLOWUP	07-06-2018	07-06-2018	5325-PETERS, ANTHONY	07-06-2018 0850-0910 FURCI-RIVERA TRK#804CHECKED AREA NO FLOOD WATER AT THIS PRESENT TIME DURING RAIN EVENT ALL BASINS TAKING WATERINSPECTION COMPLETE 7.19.18 1154 AP Input By: ANTHONY A PETERS on 7/19/2018 11:55:02 AM
FOLLOWUP	07-09-2018	07-09-2018	5325-PETERS, ANTHONY	07/09/2018 1140-1210 MARINELLI TRK#334BOLOGNA TRK#464CLEANED BASIN NO.431605 TO THE BOTTOM FUNCTIONINGNO SANITATION SWEEPER SHOWED LEFT AT 12:10 P.M.INSPECTION COMPLETE 7.19.18 1200 AP Input By: ANTHONY A PETERS on 7/19/2018 12:00:57 PM
FOLLOWUP	07-10-2018	07-10-2018	5325-PETERS, ANTHONY	07/10/2018 1225-1315 BOLOGNA TRK#464CLEANED BASIN NO.431604 TO THE BOTTOM FUNCTIONINGINSPECTION COMPLETE 7.19.18 1205 AP Input By: ANTHONY A PETERS on 7/19/2018 12:06:41 PM
FOLLOWUP	07-11-2018	07-11-2018	5325-PETERS, ANTHONY	07/11/2018 1110-1145 BOLOGNA TRK#464CLEANED BASIN TO THE BOTTOM FUNCTIONINGINSPECTION COMPLETE 7.19.18 1232 AP Input By: ANTHONY A PETERS on 7/19/2018 12:30:45 PM
FOLLOWUP	07-19-2018	07-19-2018	5325-PETERS, ANTHONY	07/19/2018 1050-1145 ABRUSCI VEH#52SCAMPBELL-SALERNI TRK#593MET WITH FLUSHER CREW AT LOCATIONFLUSHED THREE BASIN CONNECTIONS NO.431602, 431601 431607 ALL THREE FUNCTIONING INSPECTED 18-INCH COMBINED SEWER ON 48 ST FROM 37 AVE TO NORTHERN BLVD FOUND DEBRIS IN SEVERAL MANHOLES VACTOR WORK NEXT WORK TO CONTINUEINSPECTION COMPLETE 7.19.18 1245 AP Input By: ANTHONY A PETERS on 7/19/2018 12:46:25 PM
CORRECTION	07-19-2018	07-19-2018	5325-PETERS, ANTHONY	SEE OPEN W/O#844166954 TO REPAIR BASIN CONNECTION Input By: ANTHONY A PETERS on 7/19/2018 3:16:14 PM



Report Date: Thursday, May 02, 2019

Page 3 of 4

Log Type	Log Started	Log Ended	Log By	Comments
FOLLOWUP	07-24-2018	07-24-2018	5325-PETERS, ANTHONY	07.24.2018 0700-1500 MARINELLI TRK#334PRIVATE CONTRACTOR VACTOR WITH 2-LABSVACTORED M/H#4015054-TO-M/H#4018279 850 FTNO GREASE ONE CUBIC YARD OUTGOING PIPE IN M/H#4015055 IS SLIGHTLY HIGHER THAN INCOMING PIPE MAYBE 3" CAUSING MINOR HOLDING BUT NOT ENOUGH TO CAUSE PROBLEM COULD BE OVERTAXING IN M/H#4015054 DUE TO FIVE (5) CONNECTIONS COMING IN PLUS WATER FROM BASIN ON HOME DEPOT PROPERTY (NOT ON MAP) OVERFLOWING INTO STREET AND ENTERING OUR BASIN NO.461607 SPOKE TO ANDREW (HOME DEPOT MANAGER) TO HAVE CATCH BASIN CLEANED NEED E.C.B. OR RESPONSIBLE AGENCY TO FOLLOW UP WITH HOME DEPOTNEED CMOM TO INVESTIGATE OVERTAXING OF M/H#4015054 AND/OR FEASIBILITY STUDY FOR INSTALLATION OF BIOSWALES TO REDUCE FLOW SEWER IS CLEAR NO OBSTRUCTIONINSPECTION COMPLETE 7.25.18 0917 AP Input By: ANTHONY A PETERS on 7/25/2018 9:18:29 AM
FOLLOWUP	02-07-2019	02-07-2019	1193-ANZUETA, JOSEPH	Anzueta veh#37748St. - 37Ave n/w/c chute connection working improperly need to upgrade and repair same. Refer to Sewer Emergency Reconstruction. Input By: LINDA BUSH on 2/8/2019 8:08:04 AM
FOLLOWUP	02-13-2019	02-13-2019	6050-SCHWEIZER, JAMES	02/13/19 13:05-13:50SUPV: G. PETRUSO TR# 315CREW: SCHWEIZER/FANA TR# 004SOUNDED HYDRANT ON W/S/O 42 ST 1ST N/O NORTHERN BLVD NO NOISE HYDRANT ON S/S/O NORTHERN BLVD 20' E/O 42 ST NO NOISE NO MAIN ON N/S/ONORTHERN BLVD B/T 42 ST & 44 STNO FURTHER ACTION Input By: EVELYN HOPSON on 2/14/2019 6:55:57 AM

Work Order	Priority	Activity	Problem	Unit-ID	Asset	Initiated	Completed	Source	Maint-Type
844168190		CCTV		401	SMN	07-05-2018	N/A		
844175598		SCC		CB431600	STIN	07-03-2018	07-03-2018		
844175599		SCC		CB431607	STIN	07-03-2018	07-03-2018		
844175600		SCC		CB431606	STIN	07-03-2018	07-03-2018		
844175601		SCC		CB431499	STIN	07-03-2018	07-03-2018		
844175602		SCC		CB431601	STIN	07-03-2018	07-03-2018		
844175603		SCC		CB432614	STIN	07-03-2018	07-03-2018		
844175604		SCF		CB431499	STIN	07-03-2018	07-03-2018		
844175605		SCF		CB431600	STIN	07-03-2018	07-03-2018		
844175606		SCF		CB431607	STIN	07-03-2018	07-03-2018		
844175607		SCF		CB431606	STIN	07-03-2018	07-03-2018		
844175608		SCF		CB431601	STIN	07-03-2018	07-03-2018		
844175609		SCF		CB431602	STIN	07-03-2018	07-03-2018		
844175638		SCC		CB431602	STIN	07-05-2018	07-05-2018		
844175640		SCC		CB431603	STIN	07-05-2018	07-05-2018		
844175644		SCC		CB432615	STIN	07-05-2018	07-05-2018		
844175645		SCC		CB432613	STIN	07-05-2018	07-05-2018		
844175647		SCC		CB431608	STIN	07-05-2018	07-05-2018		
844175653		SA23		CB431608	STIN	07-19-2018	N/A		



Report Date: Thursday, May 02, 2019

Page 4 of 4

Work Order	Priority	Activity	Problem	Unit-ID	Asset	Initiated	Completed	Source	Maint-Type
844175663		SCC		CB431605	STIN	07-09-2018	07-09-2018		
844175666		SCC		CB431604	STIN	07-10-2018	07-10-2018		
844175692		SCC		CB431606	STIN	07-11-2018	07-11-2018		
844175700		SCF		CB431602	STIN	07-19-2018	07-19-2018		
844175702		SCF		CB431601	STIN	07-19-2018	07-19-2018		
844175703		SCF		CB431607	STIN	07-19-2018	07-19-2018		
844178537		SVAC	SSDAR	401	SMN	07-24-2018	07-24-2018	PCTR	
844272150		SRL				01-25-2019	N/A	FO-CMOM	
844272155		SRL				01-25-2019	N/A	FO-CMOM	
844272160		SA25		CB432615	STIN	01-25-2019	N/A	FO-CMOM	
844272169		SRL				01-25-2019	N/A	FO-CMOM	
844272188		SRL				01-25-2019	N/A	FO-CMOM	
844272196		SRB				01-25-2019	N/A	FO-CMOM	
844272206		WLDSC				01-25-2019	02-13-2019	FO-CMOM	
844272213		WLDSC				01-25-2019	02-13-2019	FO-CMOM	
844274546		SMREPR				01-30-2019	N/A	FO-CMOM	
844279306		SA25		CB431602	STIN	02-07-2019	N/A		
844326003		SA25		CB431606	STIN	04-23-2019	N/A		
844326019		SA25		CB431605	STIN	04-23-2019	N/A		
844326023		SA25		CB431604	STIN	04-23-2019	N/A		
844326026		SA25		CB431603	STIN	04-23-2019	N/A		
844326027		SA25		CB431602	STIN	04-23-2019	N/A		
844326029		SA25		CB431607	STIN	04-23-2019	N/A		



WO# 844168190

Non-Completed Sewer Main Work Order

Report Date: Tuesday, April 30, 2019

Page 1 of 4

Work Order#	844168190	Activity: CCTV	CLOSE CIRCUIT TV	
Address:	48 ST	Pct: 114	Zip: 11101	
Cross Street:	37 AVE			
Compass Direction:		Borough: QUEENS		
Building ID:	0	Block:	Lot: CMBD: 401	
Sewer Main ID:	401			
Qualifier:		Map#		
Area:	4	Sub-Area: 401 QUEENS COMMUNITY BOARD 1		
Location :		District: 844168190		
Initiated By:	7060	YAP, RICHMANN	Initiated: 07-05-2018 10:30 AM Scheduled: N/A	
Assigned To:		Service# 186596855	Due: N/A	
Authorization:				
Crew:				
Maint Type:				
Priority:				
Problem:			Permit#	
Project:			Completed: N/A	
Source:			Out of Service: N	
			Potential Service Request: N	
WO Responsibility:	CMOM	CAPACITY MGMT OPERATION & MAIN		
WO Comments:	Caller Comments for SR #: 186596855.....CREATED FOR THE YARD - INVESTIGATE THE AREA			
Work Order Log History				
Log Type	Log Started	Log Ended	Log By	Comments
INITIAL	07-05-2018	07-05-2018	7060- YAP, RICHMANN	Yap/Rivera veh#261During heavy rain fall (6-28-18), intersection of 48St & 37Ave flooded. Request cmom televise combined sewer to determine if combined line is adequate enough to take all that rain fall from so many catch basins attached to it. Input By: LINDA BUSH on 7/6/2018 3:03:20 PM



Report Date: Tuesday, April 30, 2019

Page 2 of 4

Work Order Log History				
Log Type	Log Started	Log Ended	Log By	Comments
RESCOM	04-24-2019	04-24-2019	12655- EDWARDS, NATALIA	<p>In response to your request (csr# 186596855 / wo# 844168190) to determine the sewer condition at the above referenced location due to chronic street flooding the sewer was cleaned and a CCTV inspection was performed between 9/19/18 and 11/2/18 under the supervision of Angelo Perrucci, David Collier, Joseph Shafer, Korab Strickani, Thé Le, Jorge Perez, Justina Luna and the following general conditions exist, as summarized by Kevin Jairam: Significant flooding occurs in this location during heavy rain events as reported by the Field Operations (see photo attached). The flooding is located at the local low point of the area. The catch basins in the vicinity are connected to an existing 18" combined sewer along 48 St and then discharges into a 28" x 42" combined sewer in Northern Blvd. The sewers were heavily impacted with silt. These sewers were cleaned and televised under Contract TV-18 (DFO#18-610). The 18" RCP combined sewer from M4015054 to M4015568 was found to be in poor condition with multiple cracks and multiple fractures. The 42" RCP/tile combined sewer from M4013797 to M4013991 was found to be in poor condition due to missing aggregate, visible surface reinforcement and missing tile. The 10" VCP combined sewer from CB432615 to M4015052 was found to be in poor condition due to broken pipe, visible soil, and deformed pipe. The 8" VCP CB431602 to CB431604 was found to be in poor condition due to a broken pipe and a hole with voids visible and deformed. The 12" VCP combined sewer from M4023688 to M4012536 was found to be in poor condition due to broken pipe, multiple cracks, deformed pipe and an eroded invert. The 15" VCP combined VCP/cement pipe from M4013998 to M4014001 was found to be in poor condition due to broken pipe, multiple fractures, deposited attached encrustation including an infiltration dripper, weeper and runner. An unmapped manhole was found 223 feet upstream from manhole M4015570. An unmapped manhole (M401835A) was found 98 feet downstream from manhole (M4018350). Manhole (M4012536B) was found 35 feet upstream diagonally from manhole (M4018350). The sewer line from manhole (M4012535) to manhole (M4018350) does not exist. Manhole (M4012536) needs to be moved and is actually located 59 feet upstream from manhole (M4012536B). A sidewalk sewer line exists between manhole (M4012536) and manhole (M4012536B). Manhole (M4012536A) was found to be 44 feet upstream from manhole (M4012536). There is a stub that is slightly upstream from manhole (M4012536A). There is a segment of pipe upstream from manhole (M4012536) that was not able to be televised. Two requests for water/sewer GIS map change were made. The RCP manhole (M4015054) was found to be in poor condition (a hole with soil visible). The RCP manhole (M4015055) was found to be in poor condition with a broken section. Two brick manholes (M4015569 & M4018279) were found to be in poor condition with multiple fractures. The RCP manhole (M4015570A) was found to be in poor condition with broken sections. Six breaksheets (wo #s 844272150, 844272155, 844272160, 844272169, 844272188, 844272196) were submitted to repair the defects mentioned above. Two requests to scan the water main (wo. #s 844272213, 844272206) were sent out to Queens Water Maintenance. Queens Water Maintenance was also notified to inform Emergency Construction on the outcome of the sounding. Options to extend and modify the existing sewer in accordance with the approved drainage plan are addressed in a separate report for this location, DFO#18-440. DFO#18-610 Input By: NATALIA EDWARDS on 4/24/2019 10:23:50 AM</p>

There are no user logs for this work order

Primary Caller Information	
Primary Caller:	Call Date: 07-02-2018 05:15 PM
Address:	
Day Phone:	
Comments:	CREATED FOR THE YARD - INVESTIGATE THE AREA

Custlog History				
Log Type	Log Started	Log Ended	Log By	Comments
INITIAL	07-05-2018	07-05-2018	7060-YAP, RICHMANN	Yap/Rivera veh#261During heavy rain fall (6-28-18), intersection of 48St & 37Ave flooded. Request cmom televise combined sewer to determine if combined line is adequate enough to take all that rain fall from so many catch basins attached to it. Input By: LINDA BUSH on 7/6/2018 3:01:55 PM
INITIAL	07-03-2018	07-03-2018	5325-PETERS, ANTHONY	48 ST BTWN 37 AND BARNETT AVES07/03/2018 0800-1205 YAP VEH#261FURCI-BULLOCK-THOMAS TRK#464/593ARRIVED AT LOCATION AND INSPECTED FOURTEEN (14) CATCH BASINS ON 48 ST FROM 37 AVE TO BARNETT AVECB#431600, 431601,431603,431604,431606,431607,431608CB #431609,432613,432615 AND 431499 ARE SINGLE HIGHWAY UNITS WITH NO CURB PIECE ELEVEN (11) IN TOTALCB#431602,431605,432614 AND 431499 ARE OPEN CURB PIECECATCH BASINS FOUR (4) IN TOTALCB#431601,431602,431603,431604,431605,431606 AND 431607 HAD DEBRIS SITTING ON TOP OF GRATE BLACK TOYOTA PRIUS (SHOWN IN E-MAIL PHOTO)STILL PARKED OVER CB#431604 WITH PASSENGER BACK TIRE SITTING OVER GRATE AND BLOCKING DRAINAGE HOLES CB#431605 HAD CARDBOX (CARTON BOX) Input By: ANTHONY A PETERS on 7/19/2018 10:34:54 AM
INITIAL	07-03-2018	07-03-2018	5325-PETERS, ANTHONY	07/03/2018 0800-1205 YAP VEH#261FURCI-BULLOCK-THOMAS TRK#593/464CLEANED TO THE BOTTOM SIX (6) CATCH BASINS FLUSHED SIX (6) BASIN CONNECTIONS ALL TAKING WATERAND CLEAN AND CLEARCB CONN NO.431601 LINER IS DETACHED FROM CROWN OF PIPE APPROX 2 FT FROM CATCH BASIN FLUSHER WAS ABLE TO RE-OPEN NOW FUNCTIONING (STILL NEEDS TO BE REPAIRED) REMOVED ABOUT TWO (2) CUBIC YARDS OF DEBRIS FROM FIVE (5) CATCH BASINS WORK TO CONTINUEINSPECTION COMPLETE 7*19*2018 1047 AP Input By: ANTHONY A PETERS on 7/19/2018 10:46:46 AM
INITIAL	07-03-2018	07-03-2018	5325-PETERS, ANTHONY	07/03/2018 0800-1205 YAP VEH#261FURCI-BULLOCK-THOMAS TRK#593/464CB#431605 HAD CARDBOX (CARTON BOX) COVERING PORTION OF GRATE PROBED ABOVE MENTIONS CATCH BASINS RELATIVELY CLEAN WORK TO CONTINUE AS BASINS BECOME ACCESSIBLE RECOMMEND CB#431603,431604,431606 AND 431607 BR REVERTED BACK TO CATCH BASINS WITH OPEN CURB PIECE TO ALLOW EXCESSIVE WATER FLOW TO EXIT INTO BASINS DURING HEAVY RAINFALL ALSO RECOMMEND L.I.R.R. ADDRESS WATER RUN-OFFAND GRAVEL DEBRIS THAT ESCAPE FROM THEIR EMBANKMENT AND GATED ACCESS WAYINSPECTION COMPLETE 7.19.18 1115 AP INSPECTION COMPLETE 7*19*2018 1047 AP Input By: ANTHONY A PETERS on 7/19/2018 11:15:54 AM
FOLLOWUP	07-05-2018	07-05-2018	5325-PETERS, ANTHONY	07-05-2018 0825-1015 MUNIZ trk#463CLEANED FOUR (4) BASINS TO THE BOTTOMFUNCTIONING OTHERS C.O.B. AT THIS TIMEINSPECTION COMPLETE 7.19.18 1133 AP Input By: ANTHONY A PETERS on 7/19/2018 11:37:28 AM
FOLLOWUP	07-05-2018	07-05-2018	5325-PETERS, ANTHONY	07-05-2018 1015-1315 MUNIZ trk#463REPAIR BASIN NO.431608 AT 48 ST AND 37 AVEREMOVE ASPHALT AND OLD CASTING INSIDE UNITNO PARKING REGULATIONS SEND WORK ORDER TO Q/REPAIRS FOR MINOR BRICKWORKINSPECTION COMPLETE 7.19.18 1148 AP Input By: ANTHONY A PETERS on 7/19/2018 11:49:36 AM
FOLLOWUP	07-06-2018	07-06-2018	5325-PETERS, ANTHONY	07-06-2018 0850-0910 FURCI-RIVERA TRK#804CHECKED AREA NO FLOOD WATER AT THIS PRESENT TIME DURING RAIN EVENT ALL BASINS TAKING WATERINSPECTION COMPLETE 7.19.18 1154 AP Input By: ANTHONY A PETERS on 7/19/2018 11:55:02 AM
FOLLOWUP	07-09-2018	07-09-2018	5325-PETERS, ANTHONY	07/09/2018 1140-1210 MARINELLI TRK#334BOLOGNA TRK#464CLEANED BASIN NO.431605 TO THE BOTTOM FUNCTIONINGNO SANITATION SWEEPER SHOWED LEFT AT 12:10 P.M.INSPECTION COMPLETE 7.19.18 1200 AP Input By: ANTHONY A PETERS on 7/19/2018 12:00:57 PM
FOLLOWUP	07-10-2018	07-10-2018	5325-PETERS, ANTHONY	07/10/2018 1225-1315 BOLOGNA TRK#464CLEANED BASIN NO.431604 TO THE BOTTOM FUNCTIONINGINSPECTION COMPLETE 7.19.18 1205 AP Input By: ANTHONY A PETERS on 7/19/2018 12:06:41 PM



Report Date: Tuesday, April 30, 2019

Page 4 of 4

Custlog History				
Log Type	Log Started	Log Ended	Log By	Comments
FOLLOWUP	07-11-2018	07-11-2018	5325-PETERS, ANTHONY	07/11/2018 1110-1145 BOLOGNA TRK#464CLEANED BASIN TO THE BOTTOM FUNCTIONING INSPECTION COMPLETE 7.19.18 1232 AP Input By: ANTHONY A PETERS on 7/19/2018 12:30:45 PM
FOLLOWUP	07-19-2018	07-19-2018	5325-PETERS, ANTHONY	07/19/2018 1050-1145 ABRUSCI VEH#525CAMPBELL-SALERNI TRK#593MET WITH FLUSHER CREW AT LOCATION FLUSHED THREE BASIN CONNECTIONS NO.431602, 431601 431607 ALL THREE FUNCTIONING INSPECTED 18-INCH COMBINED SEWER ON 48 ST FROM 37 AVE TO NORTHERN BLVD FOUND DEBRIS IN SEVERAL MANHOLES VACTOR WORK NEXT WORK TO CONTINUE INSPECTION COMPLETE 7.19.18 1245 AP Input By: ANTHONY A PETERS on 7/19/2018 12:46:25 PM
CORRECTION	07-19-2018	07-19-2018	5325-PETERS, ANTHONY	SEE OPEN W/O#844166954 TO REPAIR BASIN CONNECTION Input By: ANTHONY A PETERS on 7/19/2018 3:16:14 PM
FOLLOWUP	07-24-2018	07-24-2018	5325-PETERS, ANTHONY	07.24.2018 0700-1500 MARINELLI TRK#334PRIVATE CONTRACTOR VACTOR WITH 2-LABS VACTORED M/H#4015054-TO-M/H#4018279 850 FT NO GREASE ONE CUBIC YARD OUTGOING PIPE IN M/H#4015055 IS SLIGHTLY HIGHER THAN INCOMING PIPE MAYBE 3" CAUSING MINOR HOLDING BUT NOT ENOUGH TO CAUSE PROBLEM COULD BE OVERTAXING IN M/H#4015054 DUE TO FIVE (5) CONNECTIONS COMING IN PLUS WATER FROM BASIN ON HOME DEPOT PROPERTY (NOT ON MAP) OVERFLOWING INTO STREET AND ENTERING OUR BASIN NO.461607 SPOKE TO ANDREW (HOME DEPOT MANAGER) TO HAVE CATCH BASIN CLEANED NEED E.C.B. OR RESPONSIBLE AGENCY TO FOLLOW UP WITH HOME DEPOT NEED CMOM TO INVESTIGATE OVERTAXING OF M/H#4015054 AND/OR FEASIBILITY STUDY FOR INSTALLATION OF BIOSWALES TO REDUCE FLOW SEWER IS CLEAR NO OBSTRUCTION INSPECTION COMPLETE 7.25.18 0917 AP Input By: ANTHONY A PETERS on 7/25/2018 9:18:29 AM
FOLLOWUP	02-07-2019	02-07-2019	1193-ANZUETA, JOSEPH	Anzueta veh#37748St. - 37Ave n/w/c chute connection working improperly need to upgrade and repair same. Refer to Sewer Emergency Reconstruction. Input By: LINDA BUSH on 2/8/2019 8:08:04 AM
FOLLOWUP	02-13-2019	02-13-2019	6050-SCHWEIZER, JAMES	02/13/19 13:05-13:50 SUPV: G. PETRUSO TR# 315 CREW: SCHWEIZER/FANA TR# 004 SOUNDED HYDRANT ON W/S/O 42 ST 1ST N/O NORTHERN BLVD NO NOISE HYDRANT ON S/S/O NORTHERN BLVD 20' E/O 42 ST NO NOISE NO MAIN ON N/S/O NORTHERN BLVD B/T 42 ST & 44 ST NO FURTHER ACTION Input By: EVELYN HOPSON on 2/14/2019 6:55:57 AM

Activity Safety Messages: There are no Safety Messages for this asset's Activity Code

Asset Safety Messages: There are no Safety Messages for this asset